


A50-SLSA4-95-M42

一体型 3°

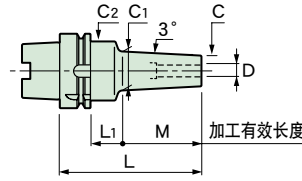

■标准附属品
●冷却液导管(固定式)→P.206

■备考
●可对应可动式冷却液导管→P.206

■注意事项
●刀具安装··插入刀具时,请务必将刀具插入比安全记号更深的位置。
●A50M 倒扣部分尺寸同规格不同。请注意是否同 ATC 臂发生干涉。

安全记号
壁厚
最短夹持长度
刀具最大插入长度

HEATROBO电磁 1200S (HRD-01S-230AS)
电磁式加热器对应表

[○] 可加热 [×] 不可加热

型号	φD	φC	t	L	M	L ₁	φC ₁	φC ₂	H	h	Kg	N	S	缩略图
A50-SLSA 3- 95-M42	3	6	1.5	95	42	27	10.4	25	9	71	0.5	5.8	9.1	○
-125-M42				125		57				101	0.6	6.5	9.8	○
-SLRA 3- 75-M22	3	7.5	2.25	75	22	27	9.8	25	9	51	0.5	6.2	2.8	○
- 95-M42				95						42		11.9	71	
-125-M42				125	57	101	0.6	7.3	6					
A50-SLSA 4- 95-M42				4	7	1.5	95	42	27	11.4	25	12	71	
-125-M42	125	57	101				0.6		7.7				7.9	
-SLRA 4- 75-M22	4	10	3	75	22	27	12.3	25	12	51	0.5	6.3	1.7	○
- 95-M42				95						42		14.4	71	
-125-M42				125	57	101	0.6	7.7	3.8					
A50-SLSA 6- 95-M42				6	9	1.5	95	42	27	13.4	25	18	71	
-125-M42	125	57	101				0.6		8				5.6	
-SLRB 6- 75-M22	6	14	4	75	22	27	16.3	32	18	50	0.5	7.2	1	○
- 95-M42				95						42		18.4	70	
-125-M42				125	57	100	0.7	10.2	1.9					
A50-SLSA 8- 95-M42				8	11	1.5	95	42	27	15.4	25	24	71	
-125-M42	125	57	101				0.6		11.8				4.4	
-SLRB 8- 75-M22	8	18	5	75	22	27	20.3	32	24	50	0.6	7.9	0.7	×
- 95-M42				95						42		22.4	70	
-125-M42				125	57	100	0.8	11.8	1.5					
A50-SLSA10- 95-M42				10	13	1.5	95	42	27	17.4	25	30	71	
-125-M42	125	57	101				0.6		12.1				3.7	
-SLRB10- 75-M22	10	22	6	75	22	27	24.3	32	30	50	0.6	8.3	0.6	×
- 95-M42				95						42		26.4	70	
-125-M42				125	57	100	0.8	13.3	1.3					
A50-SLRB12- 75-M22				12	26	7	75	22	27	28.3	42	30	52	
- 95-M42	95	42	30.4				72						0.8	6.3
-125-M42	125	57	98				1	22.9	0.8					
A50-SLRB16- 75-M22	16	32	8	75	22	27	34.3	42	32	52	0.7	6.3	0.4	○
-105-M22				105		57				78		1	19	
A50M-SLRB20- 75-M22 *1	20	38	9	75	22	27	40.3	49	40	51	0.8	6.4	0.3	○
-105-M22*1				105		57				76		1.2	15.1	

*1 使用电磁5000加热器对SLRB20加热时,所使用加热线圈号码不同.请使用加热线圈No.4进行加热.


MAKINO J

J3 / L2




φ3


A50-SLSA3-95-M42

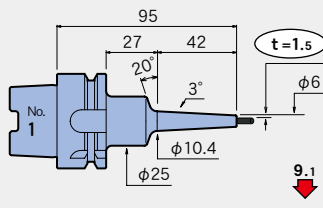


A50-SLSA3-125-M42

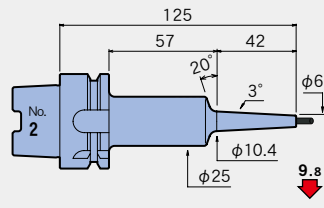


A50-SLRA3-75-M22

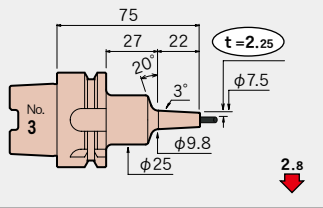

A50-SLRA3-95-M42

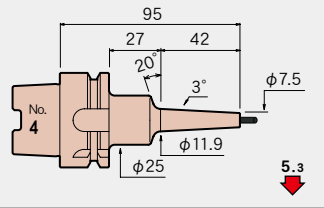


A50-SLRA3-125-M42

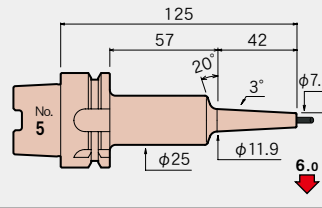


φ4


A50-SLSA4-95-M42

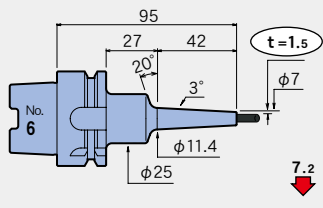


A50-SLSA4-125-M42

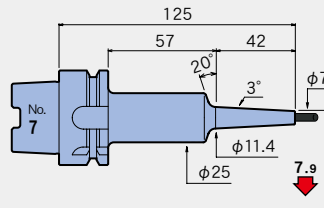


A50-SLRA4-75-M22

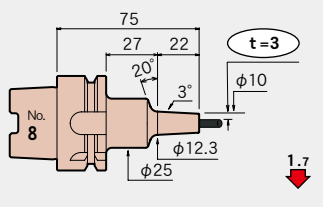

A50-SLRA4-95-M42

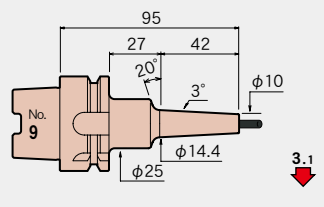


A50-SLRA4-125-M42

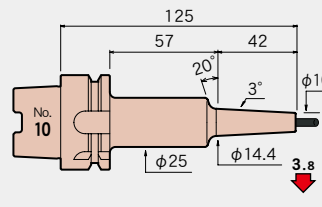


φ6


A50-SLSA6-95-M42

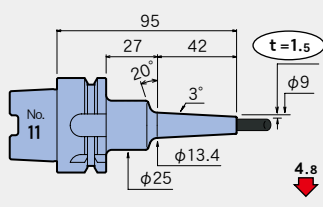


A50-SLSA6-125-M42

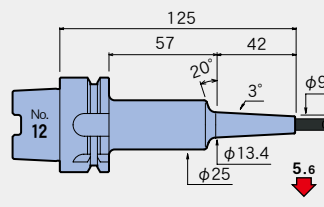


A50-SLRB6-75-M22

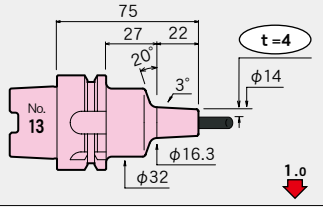

A50-SLRB6-95-M42

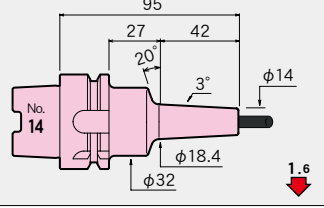

A50-SLRB6-125-M42

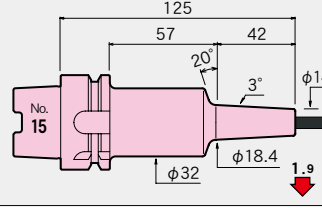

特点

加热装置

一体型 3° 一体型 CURVE

2 体型 系列

UNO

强力型 热敏刀磨

Z






直柄延长杆

相关商品






周边机器

技术资料




φ8

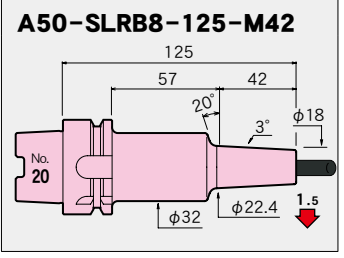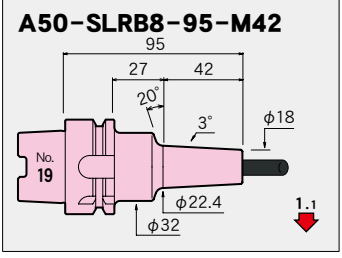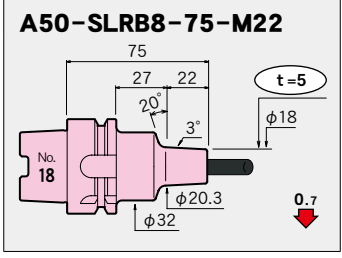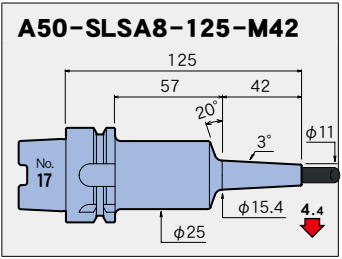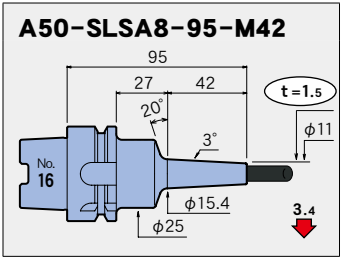



φ10

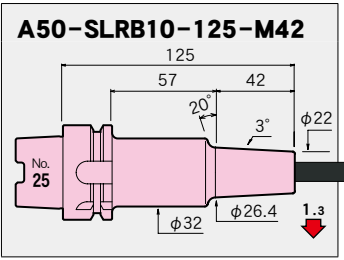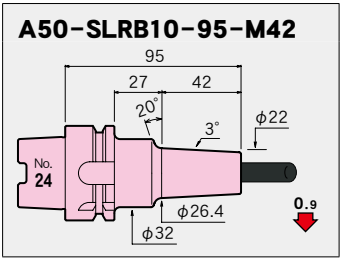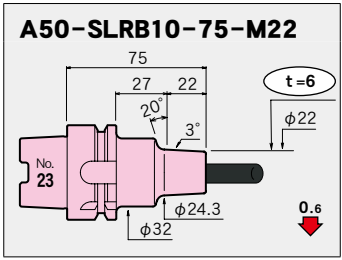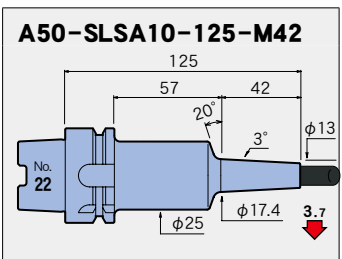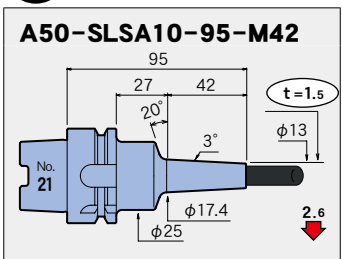

φ12

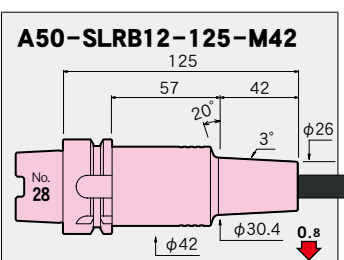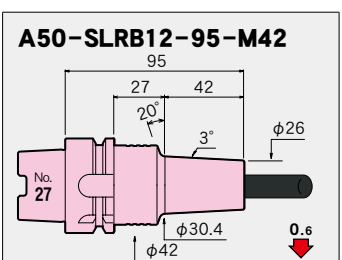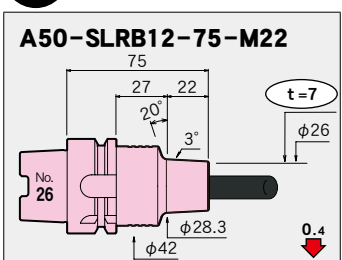

φ16

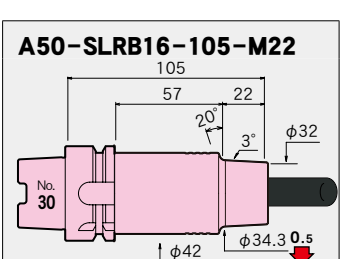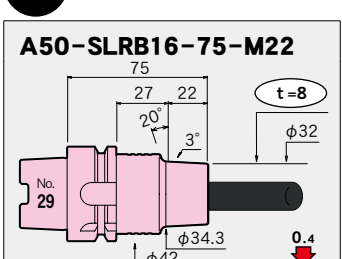

φ20

