

E40-SLK8-55



Fig. 1


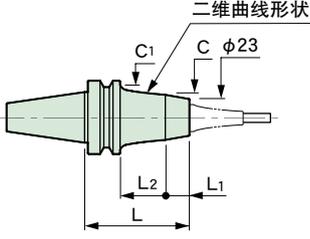


Fig. 2

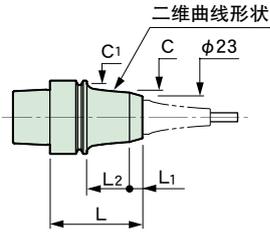

型号	Fig.	L	L ₁	L ₂	φC	φC ₁	Kg	N
BT30-SLK8-35-MAS1	1	35	13	—	—	34	0.4	1.5
-MAS2		65	15	28	27.5	34	0.6	2.3
-65-MAS1								
-MAS2	2	40	13	—	—	53	1	1.8
BT40-SLK8-40	2	70	15	28	31.2	34	1.2	2.5
-70		50	7	23	27		0.3	2.5
A40-SLK8-50	2	70	15	35	27.3	42	0.4	3.3
-70		55	7	22	28.1		0.5	4
A50-SLK8-55	2	75	15	34	28.7	53	0.6	4.8
-75		55	7	22	29.5		0.8	5.7
A63-SLK8-55	2	75	15	34	30.5	53	0.9	5.9
-75		50	7	23	27		34	0.3
E40-SLK8-50	2	70	15	35	27.3	42	0.4	2.9
-70		55	7	22	28.1		42	0.6
E50-SLK8-55	2	75	15	34	28.7	53	0.7	3.5
-75		55	7	22	29.5		53	0.8
F63M-SLK8-55	2	75	15	34	30.5	53	1	5.2
-75								

■选购品

- SLIMLINE 筒夹8型
- 六角扳手

■标准附属品

- 冷却液导管(固定式)(HSK-A)
- 拉钉(BT30)→P.204

■备考


- BT30锥柄附带专用拉钉。请确认机床品牌和型号。关于拉钉的交换请向敝司垂询。
- 可对对应可动式冷却液导管

■注意事项

- 如果无法将热装筒夹从本体上卸下时,请参照P.216页。
- HSK-E,F锥柄的刀柄没有附带冷却液导管。如需使用,请向敝司垂询。

SLIMLINE筒夹 8型

CS8-3-45

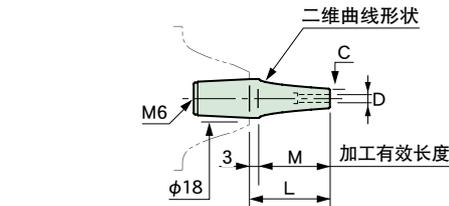

壁厚

型号	φD	φC	t	L	M	H	S	N	g	h
CS8-3-25	3	6	1.5	25	22	9	2.1	0.2	60	37.5
-45				45	42		4.8	0.4	70	57.5
-65				65	62		10.3	0.6	80	77.5
CR8-3-45	3	7.5	2.25	45	42	9	3.6	0.5	70	57.5
-65				65	62		7.4	0.7	90	77.5
-65				65	62		2.8	0.5	80	57.5
CF8-3-45	3	9.5	3.25	45	42	9	5.3	0.8	100	77.5
-65				65	62		2.8	0.5	80	57.5
-65				65	62		5.3	0.8	100	77.5
CS8-4-25	4	7	1.5	25	22	12	1.8	0.3	60	37.5
-45				45	42		4.4	0.5	70	57.5
-65				65	62		9.2	0.6	80	77.5
CR8-4-45	4	10	3	45	42	12	2.7	0.6	80	57.5
-65				65	62		5.3	0.8	100	77.5
-65				65	62		2.3	0.7	90	57.5
CF8-4-45	4	12	4	45	42	12	4.2	0.9	110	77.5
-65				65	62		2.3	0.7	90	57.5
-65				65	62		4.2	0.9	110	77.5
CS8-6-25	6	9	1.5	25	22	15	1.5	0.3	60	35
-45				45	42		3.7	0.6	80	
-65				65	62		7.6	0.8	90	
CR8-6-45	6	12	3	45	42	15	2.5	0.7	90	35
-65				65	62		4.8	1	110	
-65				65	62		2.1	0.8	100	35
CF8-6-45	6	14	4	45	42	15	3.9	1.1	120	
-65				65	62		2.1	0.8	100	35
-65				65	62		3.9	1.1	120	
CS8-8-25	8	11	1.5	25	22	20	1.4	0.4	60	37
-45				45	42		3.3	0.7	70	49
CR8-8-45	8	14	3	45	42	20	2.4	0.8	90	49
-45				45	42		2.4	0.8	90	49
CF8-8-45	8	16	4	45	42	20	2.1	1.1	110	49

■备考

- S是E40-SLK8-50与SLIMLINE热装式筒夹组合使用时的弯曲量。无论同哪种锥柄组合,其数值大致相同。

■注意事项

- 刀具安装…插入刀具时,请务必将刀具插入比安全记号更深的位置。

